

[1] 安全に関する項目～ご使用前に必ずお読みください～

このたびは、電池式直流絶縁抵抗計をお買い上げいただき、誠にありがとうございます。ご使用前にはこの取扱説明書をよくお読みいただき、正しく安全にご使用ください。そして常にご覧いただけるように製品と一緒に大切に保管してください。

- 警告マークなどの記号説明
本器および[取扱説明書]に使用されている記号と意味について
警告文はやけどや感電などの人身事故を防止するためのものです。
注意文は本器を壊すおそれのあるお取扱いについての注意文です。


- 安全使用のための警告文
以下の項目は、やけどや感電などの人身事故を防止するためのものです。本器をご使用する際には必ずお守りください。

- 最大過負荷保護入力値 (AC電圧はサイン波の実効値で規定)
ファンクション 最大定格入力値 最大過負荷保護入力値
ACV 600 AC 600 V AC 720 V
DCV 250 DC 60 V DC 120 V
MΩ, BATTERY CHECK △電圧・入力禁止

[4] 機能説明


- ファンクションスイッチ、MΩ (絶縁抵抗) 測定スイッチ
この2つのスイッチの切換えにより、次のようにファンクションやレンジが設定できます。

Table with 3 columns: ファンクションスイッチの位置, MΩ測定スイッチ(※), 測定レンジ(ファンクション)

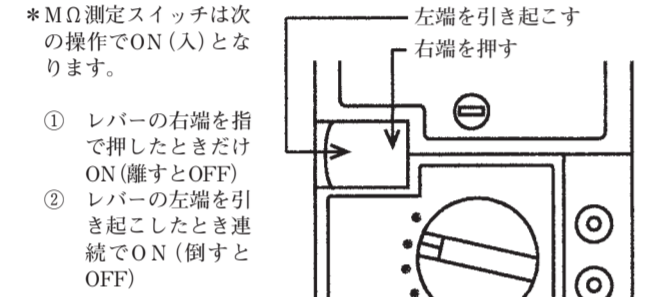

- MΩ測定スイッチは次の操作でON(入)となります。
レバーの右端を指で押したときだけON(離すとOFF)
レバーの左端を引き起こしたとき連続でON(倒すとOFF)

- メータ零位調整器
ファンクションスイッチがOFFの位置のとき、メータの指針がMΩ目盛(スケール)の∞目盛線からはずれていたら、マイナスねじで直し合せてください。

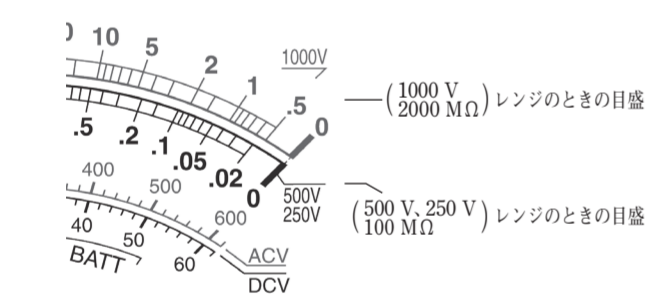


- 指示を読み取ります。
ファンクションスイッチつまみの位置(設定レンジ)により専用の目盛を使用します。(PDM5219Sは全レンジ共通の目盛です。)

- メータ零位調整器
ファンクションスイッチがOFFの位置のとき、メータの指針がMΩ目盛(スケール)の∞目盛線からはずれていたら、マイナスねじで直し合せてください。

- ディスチャージ(放電)機能について
安全のためにディスチャージが必要な理由
絶縁抵抗測定後にコンデンサや電線などの容量性の被測定物に残る高電圧を放電させ事故を防ぎます。

7-4 電池交換

- 電池交換
1. 測定端子に入力を加えた状態でリヤケースや電池ふたをはずすと、感電のおそれがあります。
2. 高電圧の発生防止のため、MΩ測定スイッチおよびファンクションスイッチつまみをOFFの位置にしてから電池交換すること。

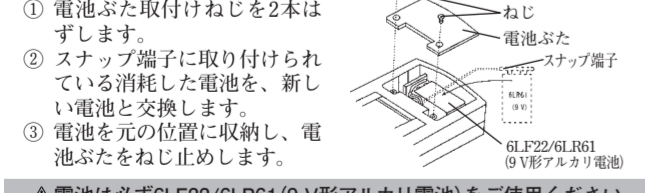

[8] アフターサービスについて

- 保証期間について
本製品の品質保証期間は、お買い上げの日より3年間です。ただし、日本国内で購入し日本国内でご利用いただく場合に限りです。また、製品本体の許容差は1年保証、製品付属の電池、テストリード等は保証対象外とさせていただきます。

- 測定対象の測定カテゴリに適したテストリードを使用すること。
測定カテゴリの違う本体やテストリードの組み合わせでは、低い測定カテゴリに制限されます。
危険な高電圧が存在する設備では事故防止のため絶縁保護器具を使用する必要があります。地域および国の安全基準に従うこと。
電池交換を除く修理・改造は行わないこと。
始業点検および年1回以上の点検は必ず行うこと。
屋内で使用する。
腐食性ガスや爆発性ガスが発生する場所では使用しないでください。
本器の保護機能が損なわれることがあるので指定されている方法以外で使用しないこと。

△ 注意

- 絶縁抵抗測定時、本器の測定端子には高電圧が発生しています。耐電圧が、低かったり不明の機器及び部品(半導体など)の接続されている回路(回路)では、破損防止上それ等を回路より外して測定することをお奨めします。特にコンピュータは要注意です。
絶縁抵抗測定では、被測定回路の使用電圧になるべく近い定格測定電圧の絶縁抵抗計で測定してください。
例 100 Vの回路では定格測定電圧125 Vの絶縁抵抗計を用いる。
強力な電磁界、静電界のある場所での測定、インバータなど高調波を多量に含む回路の測定では誤動作することがあります。

1-3 最大過負荷保護入力値 (AC電圧はサイン波の実効値で規定)

Table with 3 columns: ファンクション, 最大定格入力値, 最大過負荷保護入力値

[2] 用途と特長


- 用途
本器は低電圧電線路や機器の絶縁抵抗測定用直流絶縁抵抗計です。
特長
目盛を最小限にし、見やすさ・読みやすさを改善した3レンジ式
JIS C1302で規定された定格電流で低い絶縁抵抗値まで測定電圧を維持します。

[5] 測定方法

5-1 始業点検

- 破損のある本体やテストリードを使用しないこと。
テストリードが断線していないことを確認すること。
テストリードの断線テスト中、測定端子には高電圧が発生しているため、感電に注意すること。
感電、電池消耗防止上、測定終了後はMΩスイッチ・レバーおよび、ファンクションスイッチつまみを必ずOFF位置にすること。

測定の前に[外観][指針0位置]・[電池残量][測定用リード]の順で点検を行います。(※指針0位置とは、DC 60 V目盛の0目盛位置またはMΩ目盛の∞目盛位置)

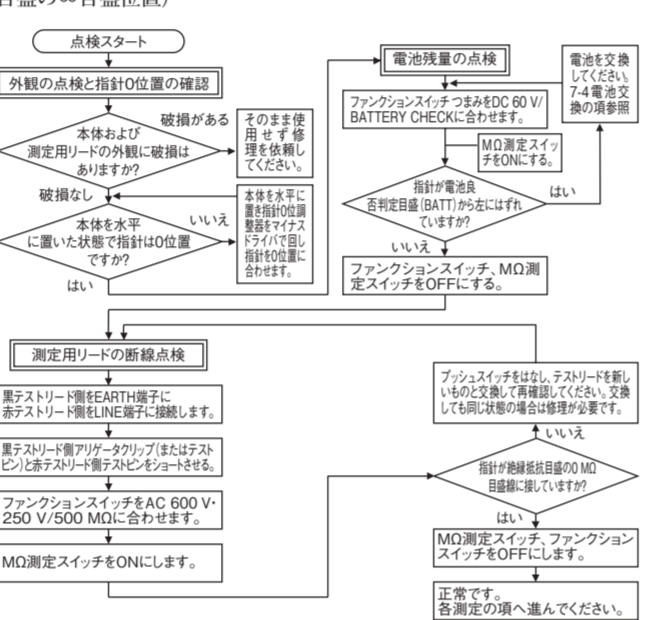


5-5 ACV(交流電圧)の測定(測定レンジはAC 600 Vレンジのみ)

- 最大定格入力値AC 600 Vを超えた電圧を加えないこと。
測定中はファンクションスイッチつまみを切り換えないこと。
MΩ測定スイッチを押したり、引き起こした状態では電圧測定をしないこと。
プレーカ付きの被測定回路では、その2次側(負荷側)で電圧の測定をすること。
感電防止のためテストリードのピンプラグや、クリップの金属部に手を触れないこと。

△ 注意

正弦波以外の波形や、50～60 Hz以外の周波数の交流では指示誤差を生じます。

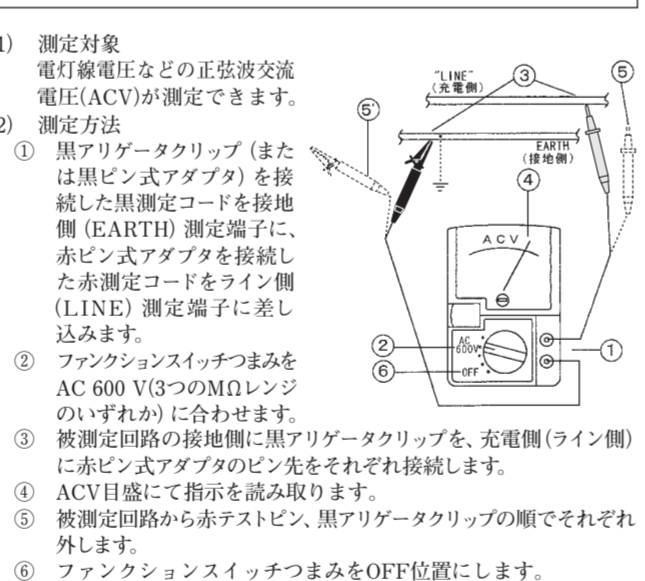

[9] 仕様

- 一般仕様
AC整流方式 : 半波整流方式(平均値指示実効値換算)
メータ仕様 : 内蔵型トートバンド方式、48 μA
電池消耗表示 : BATTERY CHECK(レンジにて確認)
許容差(温度湿度範囲) : 23±5℃ 75%RH以下 結露のないこと
使用温度湿度範囲 : 0～43℃ 80%RH以下 結露のないこと
保存温度湿度範囲 : -10～50℃ 70%RH以下 結露のないこと
使用環境条件 : 高度2000 m以下 環境汚染度Ⅱ
電源 : 6LF22/6LR61 (9 V形アルカリ電池) 9 V×1

- 仕様の詳細
出荷時の電池について
工場出荷時にモニター用電池が組み込まれておりますので、記載された電池寿命を満たすうちに切れることがあります。
モニター用電池とは製品の機能や性能をチェックするための電池のことです。
最大消費電力 : 約2.6 W(1000 V/2000 MΩレンジのとき)
測定可能回数 : 500回(1回の測定時間を、5秒間 ON/25秒間 OFF(電池寿命) とし、定格電流を流す値の抵抗器を接続、定格電圧を維持できる測定回数)
IP保護等級 : IP20
EMC指令 : IEC61326-1:2012 (EMC)



PDM1529S/PDM5219S

絶縁抵抗計 INSULATION RESISTANCE TESTER

取扱説明書 INSTRUCTION MANUAL
三和電気計器株式会社
本社=東京都千代田区外神田2-4-4 電波ビル
郵便番号=101-0021・電話=東京(03)3253-4871

5-2 電池残量の点検 (BATTERY CHECK)

- MΩ (絶縁抵抗) 測定の前に、電池残量の点検(前項5.1参照)を必ず行ってください。電池が消耗しているとき測定誤差の原因となるだけでなく、誤測定により危険です。点検方法は5-1 始業点検を参照してください。(電池は必ず6LF22/6LR61 (9 V形アルカリ電池) をご使用ください)

△ 電池残量の点検は5秒以上続けなさい。

5-3 MΩ (絶縁抵抗) の測定

- MΩ測定レンジのとき、測定端子には電圧を絶対に加えないこと。
被測定物(回路)の電源を切り離してから測定すること。
被測定回路に電圧が加わっていないことを、AC 600 Vレンジなどで確認してから測定をすること。
測定中は本器から高電圧が発生するため、テストピンやクリップ、および被測定物には手を触れないこと。
測定直後は、本器および被測定回路が高電圧で充電されているので感電に注意すること。
感電事故のおそれがあるため、測定後は必ず被測定物に充電された高電圧を放電すること。[5-4 ディスチャージ]の項参照

△ 注意

- 被測定物が接地(アース)されているときには、通常接地側に黒テストリード(EARTH)を回路側に赤テストリード(LINE)を接続します。(このように接続した方が、逆に接続した場合より一般に小さな値となる)
測定誤差を防止するため、LINE側に接続したテストリードは、被測定物や大地になるべく触れないようにして測定します。
絶縁抵抗は、温度や湿度によって大きく変化します。印加する電圧(測定電圧)によっても変化します。一般に温度、湿度、電圧がそれぞれ高い程、絶縁抵抗値は低くなります。


△ 参考

- 本器の定格電流は1 mA (1 mA～1.2 mA)です。
無負荷電圧は定格測定電圧の1.25倍以内です。
測定の際、発振音が開かなくても故障ではありません。


5-6 DCV(直流電圧)の測定(測定レンジはDC 60 Vレンジのみ)

- 最大定格入力値DC 60 Vを超えた電圧を加えないこと。
その他、前項(5-5)の警告と同様の注意をすること。


- 測定対象
バッテリーなどの直流電圧の測定ができます。
また、MΩ測定前に被測定回路の直流電圧の有無のチェックにも使えます。
測定方法
① 黒アリゲータクリップ(または黒ピン式アダプタ)を接続した黒測定コードを接地側(EARTH)測定端子に、赤ピン式アダプタを接続した赤測定コードをライン側(LINE)測定端子に差し込みます。
② ファンクションスイッチつまみをDC 60 V/BATTERYCHECKに合せてください。
③ 被測定物(回路)の一端に黒アリゲータクリップを、他端に赤ピン式アダプタのピン先をそれぞれ接続します。
④ DCV目盛にて指示を読み取ります。
⑤ 被測定回路から赤テストピン、黒アリゲータクリップの順でそれぞれ外します。
⑥ ファンクションスイッチつまみをOFF位置にします。

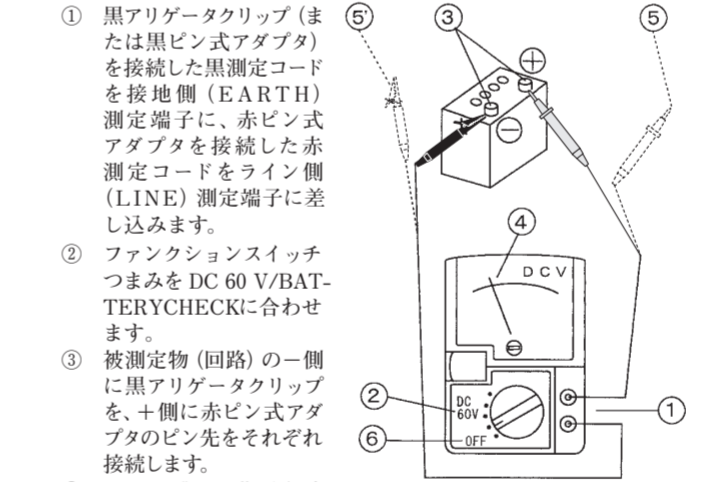

[3] 各部の名称

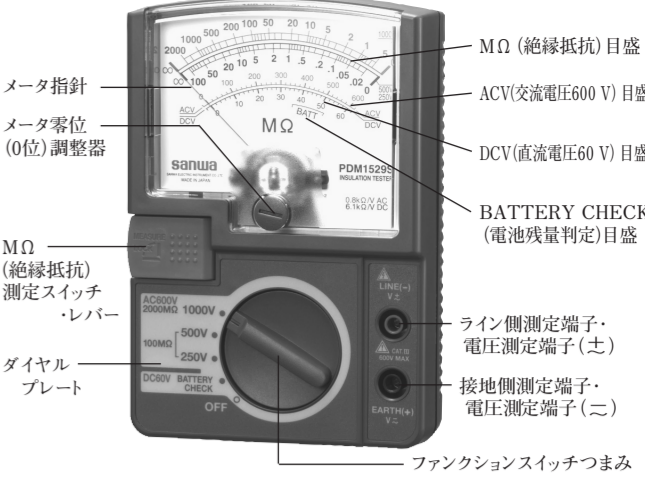

テストリード (TL-509S)

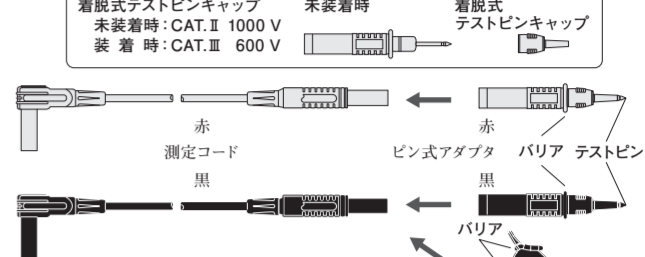


本書に掲載した製品の仕様や外観は改良等の理由により、予告なしに変更することがありますのでご了承ください。

1) 測定対象

Table with 2 columns: 機種名, 定格測定電圧
PDM1529S 250 V, 500 V, 1000 V
PDM5219S 125 V, 250 V, 500 V

- 測定レンジの選択
絶縁抵抗の測定では、特にレンジのない限り、被測定回路の使用電圧になるべく近い電圧のレンジを選びます。
例えば、100 Vの家電製品や屋内配線の絶縁抵抗測定では、125 Vの定格測定電圧のレンジを、200 Vの動力回路の測定では、250 Vの定格測定電圧のレンジを選びます。

- 測定方法
① 被測定物の電源を切ります。
② 黒アリゲータクリップ(または黒ピン式アダプタ)を接続した黒測定コードを接地側(EARTH)測定端子に、赤ピン式アダプタを接続した赤測定コードをライン側(LINE)測定端子に差し込みます。

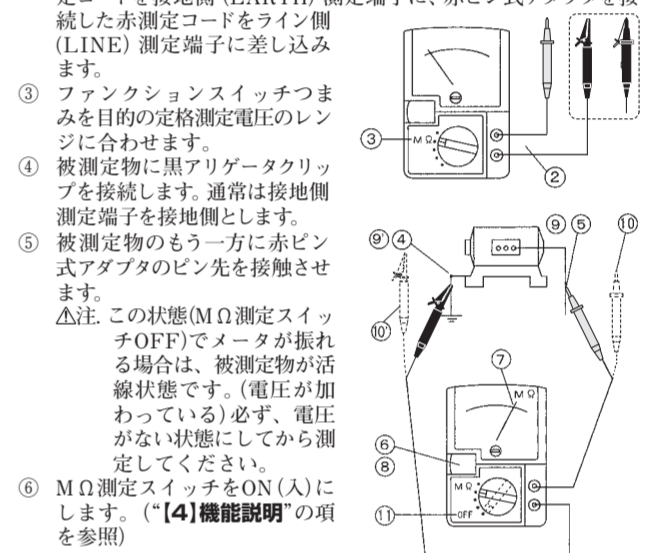

[6] 携帯ケースの使い方

- 測定時、図のように首に掛けてご使用ください。
「ふたは、方向にA点を支点に回転する」
「要らぬ底面に落ちないように、ホックで結合」
本体固定用バンド
本体入れ部分
テストリード入れ部分
音掛けで使用時
手提ずり携帯時

[7] 保守管理について

- 安全上重要項目です。説明書をよく理解して管理を行うこと。
安全と確度の維持のため1年に1回以上は校正・点検を実施すること。

- 保守点検 (5-1 始業点検 を参照してください)
1) 本体の外観 : 落下などにより、外観が壊れていないか?
2) 測定用リード : コード部分が傷んでいないか?
: 芯線などの導電部分が露出していないか?

以上に該当する場合は使用を中止し、修理または新しいものと交換してください。

- 校正 : 詳細については、三和電気計器・羽村工場サービス部までお問い合わせください。項目8-2参照

7-3 保管について

- 注意
この製品は腐食性溶剤に弱いので、シンナーやアルコールなどで拭かないこと。乾かいたい布などで軽く拭き取る。
パネル、ケースなどは熱に強い材料のため、熱を発するもの(はんだごてなど)の近くに置かないこと。
振動の多い所や落下のおそれがある所には保管しないこと。
直射日光下や高温または低温、多湿、結露のある場所では保管しないこと。(9-1項の保存温度湿度範囲参照)
長期間使用しない場合は電池を必ず抜くこと。

安全規格

- IEC61010-1:2010, IEC61010-2-030:2010 CAT.Ⅲ600 V
IEC61010-2-033:2012, IEC61010-031:2015
* 測定カテゴリⅢ (CAT.Ⅲ) : 直接、分電盤から電気を取り込む機器の一次側および分電回路からコンセントまでの回路。
製造年 : 本体裏面シリアル番号の先頭2桁で西暦20**年を示す。
寸法・質量 : 144 (H)×99 (W)×43 (D)mm, 約310 g
付属品 : 取扱説明書、テストリード(TL-509S)、携帯ケース(C-09S)

9-2 測定範囲および許容差

許容差保証範囲 : 23±5℃ 75%RH以下 結露のないこと
姿勢 : 水平±5°、外部磁界 : なし、電池電圧 : 電池有効範囲内

Table with 3 columns: 機種名, PDM1529S, PDM5219S
絶縁抵抗 (MΩ)
定格測定電圧 最大目盛値
2000 MΩ
500 V
100 MΩ
0.02~0.1~50
100 MΩ
100 MΩ
100 MΩ
0.02~0.1~50
250 V
125 V
100 MΩ
0.02~0.1~50
100 MΩ
100 MΩ
100 MΩ
0.02~0.1~50
交流電圧 (ACV)
0~600 V
直流電圧 (DCV)
0~60 V
絶縁抵抗 (MΩ)
第一有効測定範囲 : 指示値の±5%以内
第二有効測定範囲 : 指示値の±10%以内
0、∞目盛 : 目盛長さの±0.7%以内
無負荷電圧 : 定格測定電圧の-0% ~ +25%以内
定格電流 : 1~1.2 mA以内
短絡電流 : 2.9 mA以内
交流電圧 (ACV)
最大目盛値の±5%以内(正弦波交流 : 50~60 Hz)
直流電圧 (DCV)
最大目盛値の±5%以内
動作不確かさ
±30%以内 (IEC規格で許容される最大値)
変動の影響要素 [E1 : 姿勢, E2 : 供給電圧, E3 : 湿度]

sanwa.



保証規定

- 保証期間内に正常な使用状態のもとで、万が一故障が発生した場合には無償で修理いたします。但し、保証期間内であっても下記の場合は保証の対象外とさせていただきます。本保証書は、日本国内において有効です。
1. 取扱説明書に基づかない不適当な取扱い(保管状態を含む)または使用による故障
2. 弊社以外による不当な修理や改造に起因する故障
3. 天災などの不可抗力による故障や損傷、および故障や損傷の原因が本器以外の事由による場合
4. お買い上げ後の輸送、移動、落下などによる故障および損傷
5. その他、弊社の責任ではないと判断される故障
This warranty is valid only within Japan.
年月日 修理内容をご記入ください。

PDM1529S/PDM5219S INSULATION RESISTANCE TESTER

INSTRUCTION MANUAL

SANWA ELECTRIC INSTRUMENT CO., LTD.

Dempa Bldg., 4-4 Sotokanda 2-Chome
Chiyoda-ku, Tokyo 101-0021, Japan

[1] Read First: Safety Information

We thank you for your purchasing our product, the battery-driven insulation resistance tester.

This is a DC resistance tester developed under the principle to provide new and unique design and function for the measurement of insulation resistance of each kind of electric equipments. Since this tester generates high voltage, we recommend that you read this instruction manual thoroughly, and treat the tester correctly and safely. The symbols used on this tester and in this instruction manual denote the following meanings:

- ⚠ Be careful as the high voltage is impressed.
- ⚠ Be careful because there is a possibility of bodily injury or the destruction of equipment.

⚠ WARNING

To ensure that the meter is used safely, follow all safety and operating instructions.

1. Never use tester for high power or high voltage circuit.
2. Disconnect power source of the measured circuit before measuring insulation resistance.
3. High voltage is generated while measuring insulation resistance. Be cautions of electric shock.
4. After measuring insulation to avoid electric shock. Be sure to discharge the high voltage charged.
5. Never apply an input signal exceeding the maximum rating input value.
6. Never use tester for measuring the line connected with equipment (i.e. motors) that generates induced or surge voltage since it may exceed the maximum allowable voltage.
7. Never use tester if the tester or test leads are damaged or broken.
8. Never use uncased tester.
9. Always keep your fingers behind the Barriers on the probe when making measurements.
10. Be sure to disconnect the test pin from the circuit when changing the function.
11. Never use tester with wet hands or in a damp environment.
12. Use test leads matching the measurement category of the object measured. If the measurement categories of the instrument and test leads were different, the lowest measurement category would be applied.

- 1 -

13. When measuring equipment containing a hazardous charged part, it is required to wear protective gear for prevention of accidents. For details, please follow your local and national safety standards.
14. Do not attempt any alterations of original specifications.
15. To ensure safety and maintain accuracy, calibrate and check the tester at least once a year.
16. Indoor use.
17. Do not use the instrument in a place where corrosive or explosive gas is produced.
18. To prevent the protection function of the tester from being spoiled, do not use it in a method other than specified.

⚠ CAUTION

Remove components such as semi-conductors and apparatuses from the circuit of measuring object to avoid damages when withstand of the object is unknown or lower than rated measuring voltage of a resistance insulation tester, especially in case of the objects you measure connected with PCs or computers.

Maximum Overload Protection Input


Function (Range)	Maximum rating input value	Maximum overload protection input
ACV (600)	AC 600 V	AC 720 V
DCV (60)	DC 60 V	DC 120 V

[2] Applications and Features


- 2.1 Applications
 - DC insulation resistance tester to measure the insulation resistance of electric lines and electric equipment.
- 2.2 Features
 - This tester has the minimum number of scale graduations and employs a three-range system for easy viewing and readability.
 - The measured voltage is maintained until the low insulation resistance value at the rated current specified in IEC61557-2.

- 2 -

[3] Front View and Name of Each Part

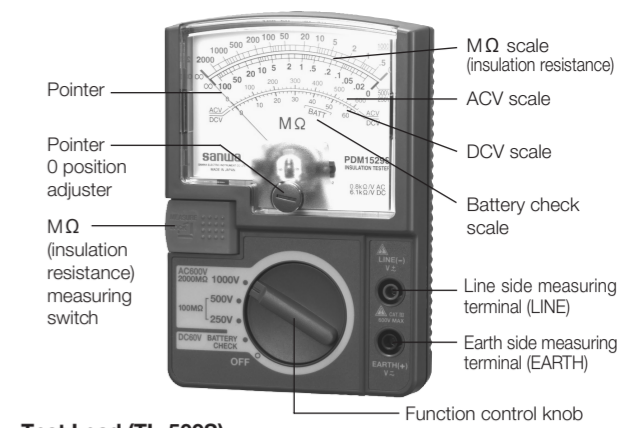

Test Lead (TL-509S)

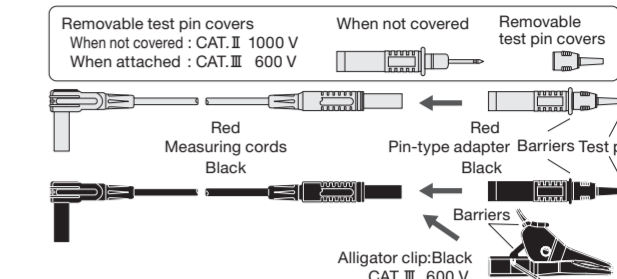

[4] Cleaning and storage

- The panel and the case are not resistant to volatile solvent and must not be cleaned with thinner or alcohol. For cleaning, use dry, soft cloth and wipe it lightly.
- The panel and the case are not resistant to heat. Do not place the instrument near heat-generating devices (such as a soldering iron).
- Do not store the instrument in a place where it may be subjected to vibration or from where it may fall.

⚠ CAUTION

- For storing the instrument, avoid hot, cold or humid places or places under direct sunlight or where condensation is anticipated. (See 9.1 Storage temperature/humidity)
- Be sure to remove the battery when the instrument is not to be used for a long period.


[5] Description of Functions

- Function control knob and MΩ (insulation resistance) measuring switch by operating these two switches, the functions and ranges can be set as shown below.

Position of Function Control Knob	MΩ Measuring Switch (*)	Set Range (Function)
AC 600 V	1000 V/2000 MΩ	AC 600 V range
	500 V/100 MΩ	
	250 V/100 MΩ	
AC 600 V	1000 V/2000 MΩ	1000 V/2000 MΩ range
	500 V/100 MΩ	500 V/100 MΩ range
	250 V/100 MΩ	250 V/100 MΩ range
DC 60 V · BATTERY CHECK	OFF	DC 60 V range
	ON	BATTERY CHECK range

- * The MΩ measuring switch is turned on by the following operation.

- ① ON only when the right end of the lever is pressed with a finger. (OFF when the finger is released)
- ② Continuously ON when the left end of the lever is raised. (OFF when it is laid down)

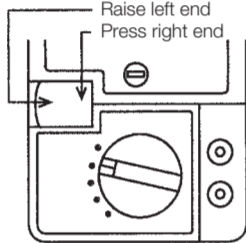


- Meter zero position adjustment
If the meter pointer is not on the ∞ graduation line of the MΩ scale when the function control knob is at OFF, adjust the zero position with a screwdriver.

- 4 -

How To Use Carrying Case

During measurement, set the case as illustrated and hang it from the neck.

- Lid turns in pivot direction at the A.
- Lay it along the bottom of the box and secure it by hooks marked by *

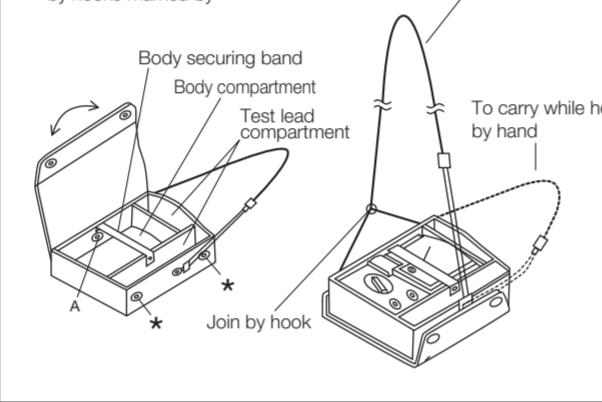

[6] Measuring Method


6.1 Start-up Check

⚠ WARNING

1. Do not use a damaged tester or test lead.
2. Make sure test lead wiring is not broken.
3. When testing the continuity of a test lead, the measuring terminals are under a high voltage. Be careful of electric shock.
4. To prevent electric shock and battery consumption, be sure to turn the MΩ measuring switch and function control knob to OFF after measurement.

- 5 -

Before starting wiring measurement, check the "appearance", "pointer 0 position" (*), "battery" and "measuring lead" in this order. (*The pointer 0 position is the 0 position of the DC 60 V scale or ∞ position of the MΩ scales.)

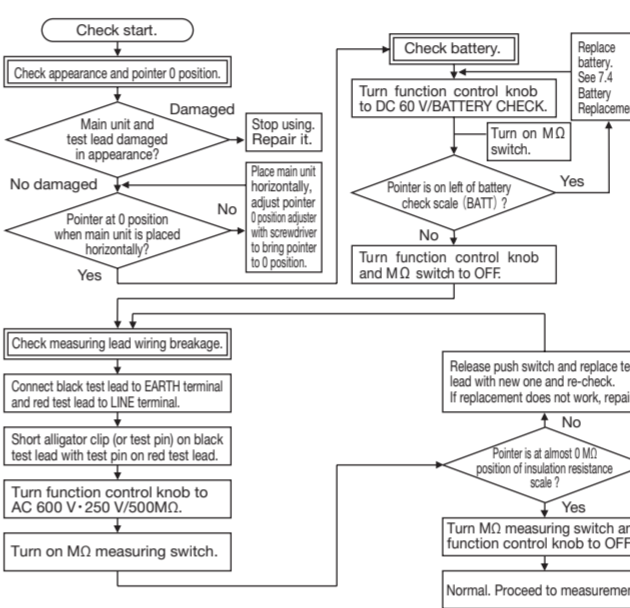

- 6 -

6.2 How to Check the Battery (BATTERY CHECK)

Prior to MΩ (insulation resistance) measurement, be sure to check the battery. A consumed battery will cause not only measurement errors but danger due to erroneous measurement.

For checking methods, refer to 6.1 Start-up Check.

⚠ Do not check the battery for more than 5 seconds.

- 6 -

6.4 Discharge Function

- 1) Reason of a need to discharge
For safety, high voltage remaining in capacitive measuring objects such as capacitors and electric wire must be discharged to prevent accidents.
- 2) Discharging method
This procedure follows the step ⑧ of 6.3-4)
 - ① When the MΩ measurement has been completed, turn off only the MΩ measuring switch with the test pin and the alligator clip connected to the measuring object.
 - ② The pointer deflects to the right and its deflection becomes smaller as time passes (indicating the charged charge is being discharged).
 - ③ When the pointer stops at zero (∞ of the MΩ scale) and discharge has been completed, conduct the steps ⑩ and ⑪ of 6.3-4)

6.5 Measurement of ACV (AC voltage) (Measuring range is the AC 600 V range only)


⚠ WARNING

1. Do not apply a voltage exceeding the maximum rated voltage of 600 VAC.
 2. During measurement, do not operate the function control knob.
 3. Do not measure a voltage with the MΩ measuring switch being pressed or raised.
 4. When the circuit to measure has a breaker, measure the voltage on the secondary side (load side).
 5. To prevent electric shock, do not touch the metal part of the pin plug and clip.
- 1) Measuring object
Sinusoidal AC voltages (ACV) such as lighting line voltages can be measured.
 - 2) Measuring method
 - ① Insert the black measuring cord to which the black alligator clip (or black pin-type adapter) is attached into the EARTH (ground) measuring terminal, and the red measuring cord to which the red pin-type adapter is attached into the LINE measuring terminal.

- 10 -

⚠ CAUTION


- AC voltages of waveforms other than sinusoidal waveforms and frequencies other than 50 to 60 Hz will cause an indication error.
- ② Turn the function control knob to AC 600 V.
 - ③ Connect the black alligator clip to the earth (grounding) side of the object measured, and connect the tip of the red pin-type adapter to the charging side of the object measured.
 - ④ Read the indicated value on the ACV scale.
 - ⑤ First remove the red test pin from the object measured, and then disconnect the black alligator clip from it.
 - ⑥ Turn the function control knob to the position of OFF.

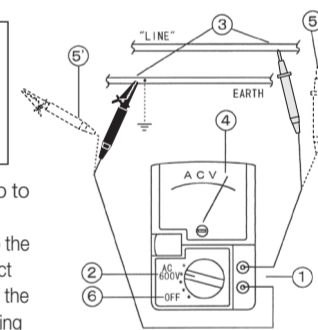

6.6 Measurement of DCV (DC voltage) (Measuring range is the DC 60 V range only)

⚠ WARNING

1. Do not apply a voltage exceeding the maximum rated voltage of 60 VDC.
 2. Keep in mind the warnings of 6.5 described earlier.
- 1) Measuring object
DC voltages of batteries, etc. can be measured. Also, the tester can be used to check the presence of DC voltage prior to MΩ measurement.
 - 2) Measuring method
 - ① Insert the black measuring cord to which the black alligator clip (or black pin-type adapter) is attached into the EARTH (ground) measuring terminal, and the red measuring cord to which the red pin-type adapter is attached into the LINE measuring terminal.

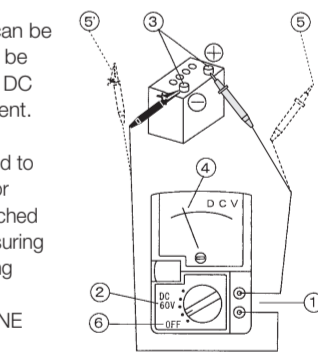

- 11 -

⚠ REFERENCE

1. The rated current of this tester is 1 mA (1 mA to 1.2 mA).
2. The no-load voltage is within 1.25 times the rated measuring voltage.
3. While measuring there may be an oscillator noise from the meter, but this is not a malfunction.

- 1) Measuring object
Measurement of insulation resistance (MΩ) of electric equipment and circuits.
- 2) Rated measuring voltage

Model	Rated measuring voltage
PDM1529S	250 V/500 V/1000 V
PDM5219S	125 V/250 V/500 V

- 3) Selection of a measuring range
When measuring insulation resistance, select a range of the voltage that is close to the voltage used by the circuit to measure, unless otherwise specified.

For example, when measuring insulation resistance of 100 V home appliances and indoor wiring, select the 125 V rated measuring voltage range and when measuring 200 V power circuits, select the 250 V rated measuring voltage range.


- 4) Measuring method
 - ① Power off the measuring object.
 - ② Insert the black measuring cord to which the black alligator clip (or black pin-type adapter) is attached into the EARTH (ground) measuring terminal, and the red measuring cord to which the red pin-type adapter is attached into the LINE measuring terminal.
 - ③ Turn the function control knob to a desired rated measuring voltage range.
 - ④ Connect the black alligator clip to the object measured. Usually connect the EARTH (ground) measuring terminal to the grounding side.

- 8 -


- ⑤ Connect the tip of the red pin-type adapter to the other side of the object measured.

⚠ CAUTION : If the meter deflects in this state, the measuring object is charged. Be sure to remove the voltage prior to measurement.

- ⑥ Turn on the MΩ measuring switch. (See [5] Description of Functions)
- ⑦ Read the indicated value. Use the appropriate scale according to the position of the function control knob (set range). (See the following fig.)
- ⑧ Turn off the MΩ measuring switch.
- ⑨ Discharge the high voltage charged in the measuring object. (See 6.4 Discharge Function.)

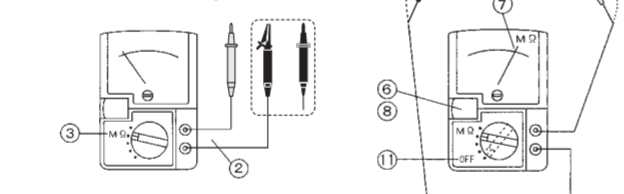

- ⑩ First remove the red test pin from the object measured, and then disconnect the black alligator clip.
- ⑪ Be sure to turn the function control knob to the position of OFF.

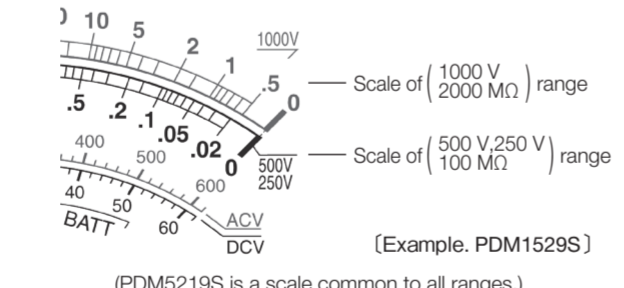


- 9 -

- ② Turn the function control knob to DC 60 V / BATTERY CHECK.
- ③ Connect the black alligator clip to the - side of the object (circuit) measured, and connect the tip of the red pin-type adapter to the + side.
- ④ Read the indicated value on the DCV scale.
- ⑤ First remove the red test pin from the object measured, and then disconnect the black alligator clip from it.
- ⑥ Turn the function control knob to the position of OFF.

[7] Battery Replacement

- ① Remove two battery lid securing screws.
 - ② Replace the consumed battery that is connected to the snap terminal with a new one.
 - ③ Set the battery in the original place and secure the battery lid with screws.
- ⚠ Be sure to turn the function control knob to the position of OFF prior to replacing the battery.
- ⚠ Be sure to use the alkaline battery 6LR61 (6LF22) x1 (9 V)

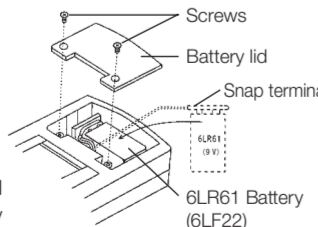

[8] After-Sales Service

- 8.1 Warranty and Provision
Sanwa offers comprehensive warranty services to its end-users and to its product resellers. Under Sanwa's general warranty policy, each instrument is warranted to be free from defects in workmanship or material under normal use for the period of one (1) year from the date of purchase.
This warranty policy is valid within the country of purchase only, and applied only to the product purchased from Sanwa authorized agent or distributor.
Sanwa reserves the right to inspect all warranty claims to determine the extent to which the warranty policy shall apply. This warranty shall not apply to test leads, disposables batteries, or any product or parts, which have been subject to one of the following causes:
1. A failure due to improper handling or use that deviates from the instruction manual.

- 12 -

2. A failure due to inadequate repair or modification by people other than Sanwa service personnel.
3. A failure due to causes not attributable to this product such as fire, flood and other natural disaster.
4. Non-operation due to a discharged battery.
5. A failure or damage due to transportation, relocation or dropping after the purchase.

8.2 Repair

- Customers are asked to provide the following information when requesting services:
1. Customer name, address, and contact information
 2. Description of problem
 3. Description of product configuration
 4. Model Number
 5. Product Serial Number
 6. Proof of Date-of-Purchase
 7. Where you purchased the product
- 1) Prior to requesting repair, please check the following:
Capacity of the battery, polarity of installation and discontinuity of the test leads.
 - 2) Repair during the warranty period:
The failed meter will be repaired in accordance with the conditions stipulated in 8-1 Warranty and Provision.
 - 3) Repair after the warranty period has expired:
In some cases, repair and transportation cost may become higher than the price of the product. Please contact Sanwa authorized agent / service provider in advance.
The minimum retention period of service functional parts is 6 years after the discontinuation of manufacture. This retention period is the repair warranty period. Please note, however, if such functional parts become unavailable for reasons of discontinuation of manufacture, etc., the retention period may become shorter accordingly.
 - 4) Precautions when sending the product to be repaired
To ensure the safety of the product during transportation, place the product in a box that is larger than the product 5 times or more in volume and fill cushion materials fully and then clearly mark "Repair Product Enclosed" on the box surface. The cost of sending and returning the product shall be borne by the customer.

8.3 SANWA web site

https://www.sanwa-meter.co.jp
E-mail: exp_sales@sanwa-meter.co.jp

- 13 -

[9] Specifications

- 9.1 General Specifications
AC rectifying method : Half-wave rectification
(Mean value indication rms value converted)
Meter specification : Inner-pole type taft-band system, 48 μA
Battery consumption : Checked by BATTERY CHECK range.
Allowable temperature/humidity range : 23±5 °C, 75 % RH max., no condensation.
Service temperature/humidity : 0~43 °C, 80 % RH max., no condensation.
Storage temperature/humidity : -10~50°C, 70 % RH max., no condensation.
Service ambient condition : Altitude 2000 m max., environmental pollution II.
Power supply : Layer built type alkaline battery 6LR61(6LF22) x1 (9 V)
* Factory-preinstalled battery
A battery for monitoring is preinstalled before shipping, therefore it may run down sooner than the battery life specified in the instruction manual. The "battery for monitoring" is a battery to inspect the functions and specifications of the product.
Max. power consumption: Approx 2.6 W (at 1000 V/2000 MΩ range)
Battery life : When the lower limit measurement resistance value that can maintain the rated output voltage is measured and if one cycle for the measurement is defined as ON for 5 seconds and OFF for 25 seconds, the battery life is 500 cycles.
Degree of IP : IP20
EMC Directive : IEC61326-1:2012 (EMC)
Safety : IEC61010-1:2010, IEC61010-2-030:2010 CAT.III 600 V, IEC61010-2-033:2012, IEC61010-031:2015
* Measurement Category III : Line from the primary side or branch of equipment (CAT. III) which directly takes in electricity from a distribution board to the receptacle.
Year of manufacture : The first two digits of the serial number on the bottom of this product indicate the last two digits of the year.
Size and mass : 144 (H) x 99 (W) x 43 (D) mm, approx. 310 g
Accessories : Test lead TL-509S, 1 set
Carrying case C-09S, 1 piece
Instruction manual, 1 copy

- 14 -

9.2 Measurement Range and Accuracy

Accuracy assurance : 23±5 °C 75 % RH max.
No condensation
Attitude: Horizontal ±5°. External magnetic field: Not present.
Battery voltage: Within the range in which the battery power is effective.

Model	PDM1529S	PDM5219S
MΩ (Insulation Resistance)	Rated measuring voltage	Rated measuring voltage
	Maximum value	Maximum value
	1000 V	500 V
	2000 MΩ	100 MΩ
Accuracy	1st effective measurement range	1st effective measurement range
	2nd effective measurement range	2nd effective measurement range
	No load voltage	No load voltage
	Rated current	Rated current
ACV	0-600 V	0-60 V
	DCV	0-60 V
Operating Instrumental uncertainty	MΩ range	MΩ range
	DCV range	DCV range

- 15 -